

Repair instruction

Description: SC200/400 Tank Lock clip

Part number: 2384978/5180116

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	Flat screwdriver

A

Turn the waste-holding tank upside down, place flat screwdriver under clip and lift it up gently.



B

Take complete clip out and press new lock clip in.



Repair instruction

Description: SC250/400 Seal mechanism

Part number: 50724

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	-

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out and place it upside down.



C

Remove seal from mechanism and place new one.



D

For assembling mechanism follow steps in reverse.

Repair instruction

Description: SC250/400 Blade

Part number: 50731

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	Crosshead screwdriver

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out and place it upside down.



C

Remove 3 screws out of retainer.



D

Press two ribs from
retainer in and take it off.
Remove blade arm.



E

Take 1 screw out of
bushing and remove
blade driver.



F

Take bushing out and
remove blade.



G

For assembling new blade follow steps in reverse.

Repair instruction

Description: SC250/400 Vent button

Part number: 0752492/3230716

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot.



B

Take complete mechanism out.



C

While pressing with your thumb the button in, pull on the inside the seal retainer loose.




D

Take new seal retainer and place it through the hole where the button needs to be pressed in.



E

Press button with spring back into position.

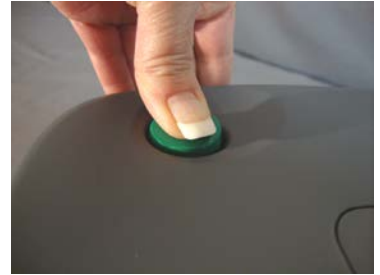

F

Place mechanism and use sliding cover in reverse to position back into the tank.



Repair instruction

Description: Pump C402C/X

Part number: 16374

Look for Service Centers, Point of Sale addresses and other information on: www.thetford-europe.com

Version: V1

Date: 09/11/2006

Tools required: Knife + blow-drier + wire stripper + crimps

A

C402 C/X toilet.



B

Remove the handle.



Remove the control panel.

C

Remove the control well.



Inside view.

09/11/2006

Description: Pump C402
C/X

1

D

Remove the seal from the control well.



E

Take the pump out of the watertank.

Cut the cable just above the pump with the wire stripper.



F

Cut the white wire insulation off so that the blue and brown wire stay intact.

Strip the blue and brown wire with the wire-stripper.



G

Place the shrink tube on the wires from the new pump.

Connect the wires to each other (blue-blue/brown-brown) with the connector pliers.

Place the shrink tube on the connector pliers.



H

Melt the shrink tube with the blow drier.
Will prevent a short circuit.



I

Replace the pump.
Replace the seal
in the control well.



J

Replace the control
well.
Replace the control
panel.



K

Replace the handle.



Repair instruction

Description: Relais C403L

Part number: 20106

Look for Service Centers, Point of Sale addresses and other information on: www.thetford-europe.com

Version: V1

Date: 05/06/2006

Tools required: -

A

C403L toilet.



Control panel
C403L.

B

Remove the
handle.




Remove the control
panel.

C

Unscrew the screw
from the relais.

remove the relais
from the connection
relais.

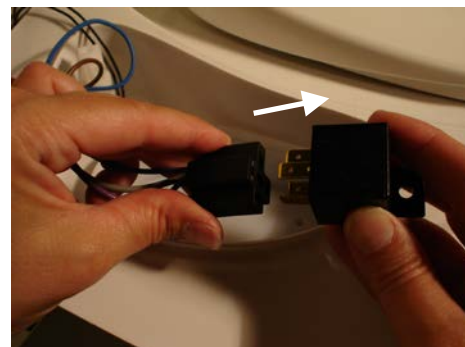

05/06/2006


Description: Relais
C403L

1

D

Place the new relais on to the connection relais.

Screw the new relais into the control well.

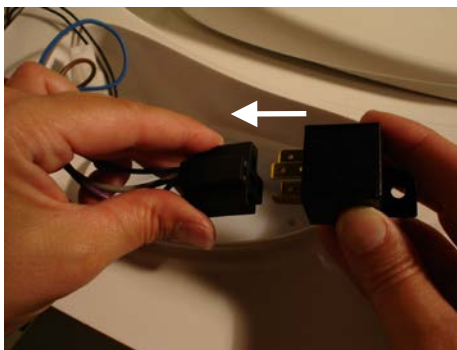

E

Replace the control panel.

Replace the handle.



F



Repair instruction

Description: Blade fuse C400

Part number: 21766

Look for Service Centers, Point of Sale addresses and other information on: www.thetford-europe.com

Version: V2

Date: 13/07/2006

Tools required: -

A

C400 toilet.

Pull the waste tank out of the Cassette toilet by lifting up the green clip.

Remove the reed switch HT.



B

Remove the blade fuse.

Place the new blade fuse back into the reed switch HT.



C

Replace the reed switch HT.

Place waste tank back into the toilet.



Repair instruction

Description: Electric Valve C403L

Part number: 23709

Look for Service Centers, Point of Sale addresses and other information on: www.thetford.eu

Version: V1

Date: 02/06/2006

Tools required:

A

C403L toilet.



Remove the handle.

B



Remove the control panel.



Remove the control well.

C

Remove the vacuum breaker by pressing against the upstanding rib.

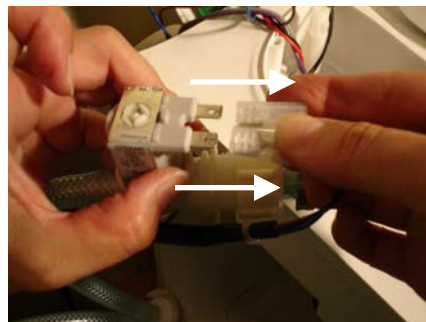
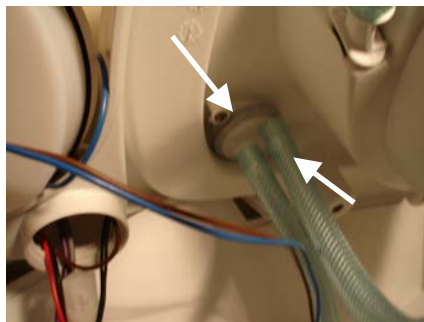


Remove the both connectors loose from the electric valve.

D

Unscrew the hose barb.



Remove the water tube from the electric valve.

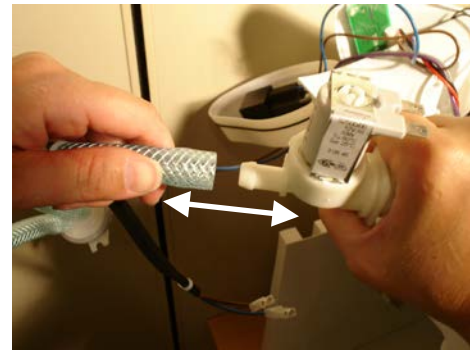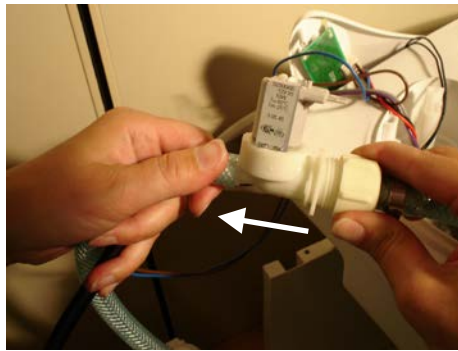

E

Replace the water tube on the new electric valve.



Screw the hose barb onto the electric valve.

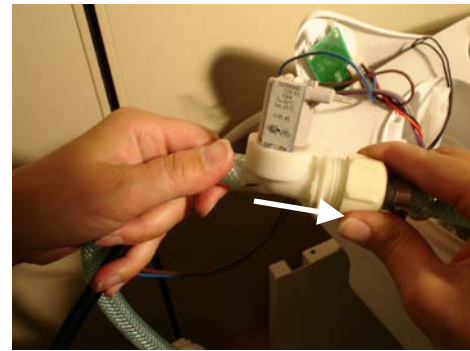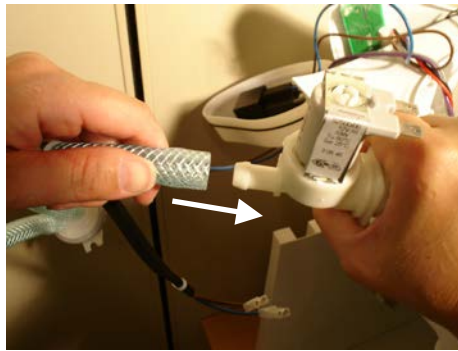

F

Replace the connectors onto the electric valve.

Replace the vacuum breaker by pressing against the upstanding rib.

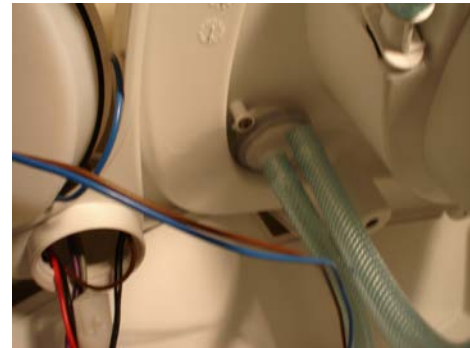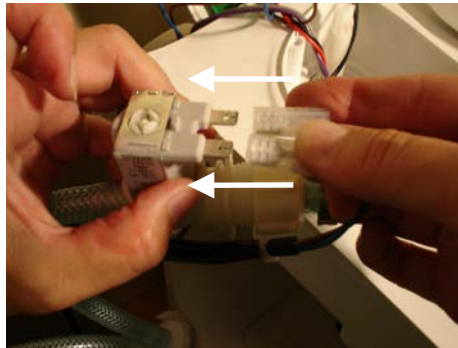

G

Replace the control well.

Replace the control panel.



H

Replace the handle.



Repair instruction

Description: SC400 Blade opener

Part number: 3230016

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out and place it upside down.



C

Press two ribs on retainer in and pull it of the blade opener



D

Press two ribs from blade opener in which allows to pull out the blade opener from the other side.

Note: While pressing blade opener out, press with your thumb on the blade, will hold the mechanism together.



E

For assembling new blade opener, follow the steps in reverse.

Note: when placing the retainer please make sure that the white pin is situated on the dot on mechanism.



Repair instruction

Description: SC400 Holdingtank plate left/right

Part number: 3230206/3232806

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

Crosshead screwdriver/flat screwdriver

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out and place it upside down.



C

Remove 3 screws out of retainer.



D

Press two ribs from retainer in and take it off and remove blade arm?.



E

Take 1 screw out of bushing and remove blade driver.



F

Take bushing out and remove blade.



G

Place flat screwdriver between retainer and rib and take complete float arm out.



H

Press two ribs from blade opener in which allows to pull out the blade opener from the other side.



I

Take 6 screws out of seal retainer and take lip seal out.



J

Remove seal of mechanism.




K

For assembling mechanism follow steps in reverse.

Note: when placing the seal retainer please make sure that the small pivot is falling in the retainer.



Note: when placing the retainer please make sure that the white pin is situated on the dot on mechanism.

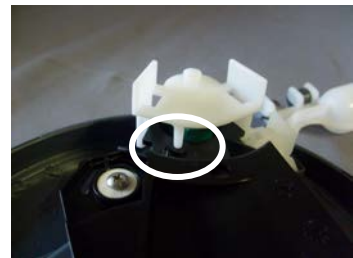

Repair instruction

Description: SC400 Float arm

Part number: 32304

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	Flat screwdriver

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out.




C

Take float arm out and place flat screwdriver between retainer and plate.



D

Place new float arm by pressing in the retainer.

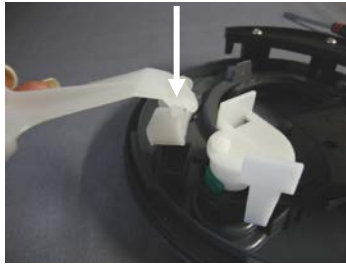

E

Place complete mechanism back and use sliding cover in reverse to position complete mechanism back into the tank.



Repair instruction

Description: SC400 Automatic vent

Part number: 32305

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	Flat screwdriver

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out.




C

Place flat screwdriver under plate and press it out.



D

Remove plate.

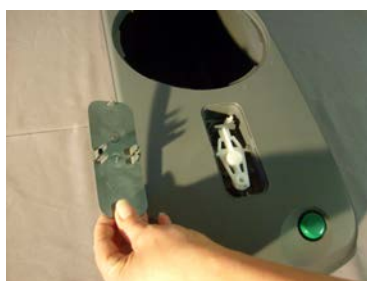

E

While going with one hand in the waste-holding tank, press the float from the top so that the foam-float can be turned out from within the Holding tank.



Now the seal can be pulled out.



F

For assembling new automatic vent, follow these steps in reverse.

Repair instruction

Description: SC400 HT Wheels

Part number: 3230806

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-

A

Turn the waste-holding tank upside down.



B

Push/pull the wheel out of it's situe.




C

Push new wheel back into position.




32311 SC400 Wall seal

Before putting on the wall seal take off a small length of the protection sheet at both corners of the tape at the back side of the wall seal. ($\pm 25\text{mm}$)

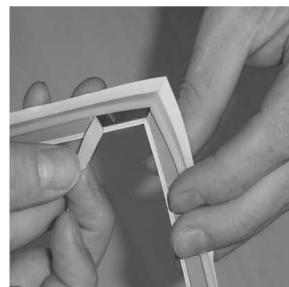

Start applying the seal first at both corners of the toilet. Then divide the remaining length along the back.

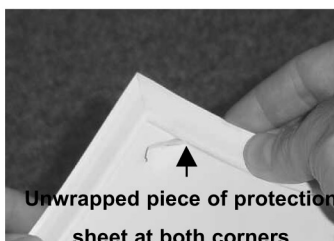

Apply seal at both sides.

Note: make sure that left and right side are well attached.



Start removing the protection sheet off the tape at the back side of the toilet.

Note: Support the seal while removing, to ensure it's positioned well before the tape fixates to the toilet.



Remove the protection sheet off the tape at the left & right side of the toilet. For the sides, start removing the sheet at the free hanging end of the seal at the bottom.

Note: support the seal while removing the sheet, to ensure it's positioned well before the tape fixates to the toilet. When all protection sheet is removed, press the wall seal again firmly with your hands on the toilet.



Finally, cut the seal at length



Repair instruction

Description: SC400 Control panel

Part number: 32313-62/32320-62/32322-62

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	V1
Date:	June 2010
Tools required:	-



A

Remove the handle and, remove the control panel.



B

Remove the plugs on the control panel carefully by pushing on the clip and, refit the plugs onto the new control panel.

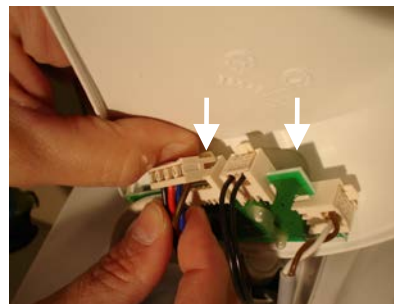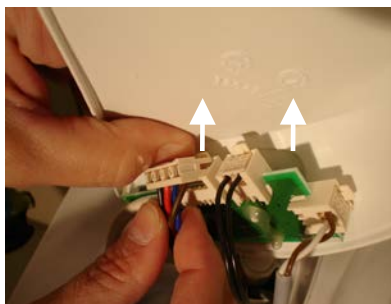

C

Replace the control panel and, place the handle.



Repair instruction

Description: SC403L/402C/402X Overlay

Part number: 32314/32321/32323

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	-

A

Pull overlay loose from control panel.



B

Place new overlay.



Note: holes which are shown when overlay has been taken off, is depending of the toilet type.

Repair instruction

Description: SC402 Waterfill funnel

Part number: 3231506

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-

A

Take waste-holding tank out of the toilet.



B

Swing the waterfill funnel outside and press it down.



C

Press new waterfill funnel in. Note: first push the rear of the funnel in position then pull the front up.



Repair instruction

Description: SC400 Reed switch waste-holding tank

Part number: 32316-62/32317-62

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	V1
Date:	June 2010
Tools required:	-



A

Pull the waste tank out of the Cassette toilet by lifting up the green clip and remove the reed switch.



B

Disconnect the reed switch carefully and connect the new reed switch.

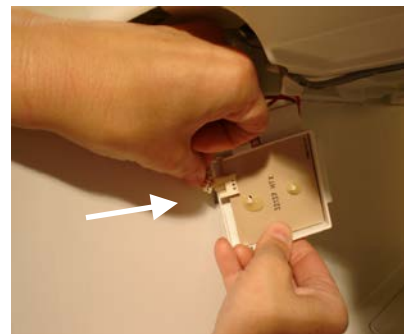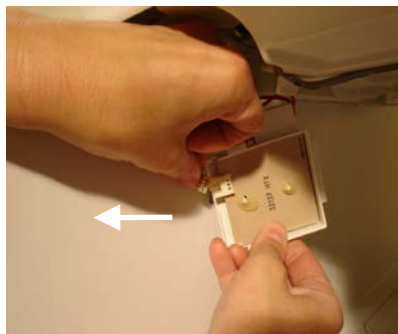

C

Place the new reed switch back into the toilet and place waste tank back into the toilet.



Repair instruction

Description: Reed Switch WT C402X

Part number: 32317-62

Look for Service Centers, Point of Sale addresses and other information on: www.thetford-europe.com

Version: V1

Date: 02/06/2006

Tools required: 

A


C402X toilet.

Pull the waste tank out of the toilet by lifting up the green clip.



B


Unscrew the reed switch WT.

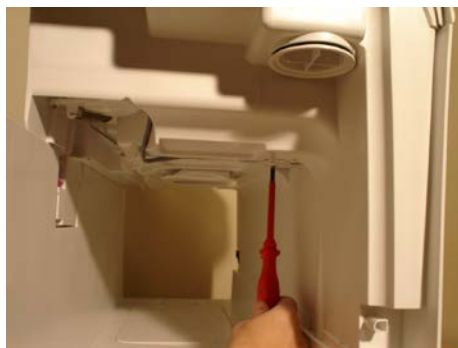

C

Disconnect the reed switch WT carefully.

Connect the new reed switch WT.

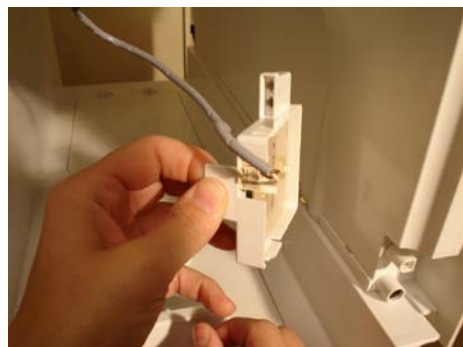

C

Screw the reed switch WT back into the toilet.

Place the waste tank back into the toilet.



Repair instruction

Description: SC400 Wire harness

Part number: 32319

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	June 2010
Tools required:	Cutter, nose pliers, philips screwdriver

Note: for this repair the toilet needs to be removed from the vehicle.

A

Remove waste-holding tank out of Cassette toilet and pull handle from control panel.




B

Pull control panel loose.



C

Cut the tyrap and release connector by pressing lip on connector housing.

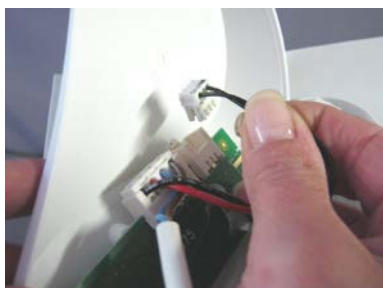

D

Swing waterfill funnel out.



E

Look up inside the toilet where you will find the pivot of the shaft, is held by 3 screws. Remove spring from shaft.




F

Remove 3 screws from pivoting bracket, and remove bracket.



G

Remove tyrap on cable inside and backside of the toilet.

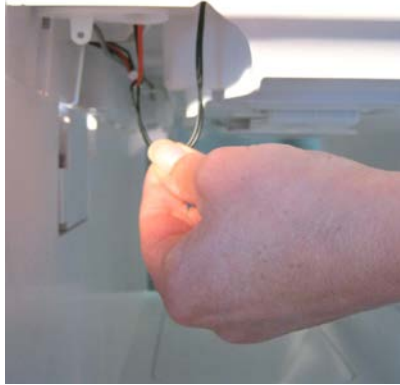


H

Remove reed switch housing by pressing both lips on the side.



I

Release connector by pressing lip on connector housing.

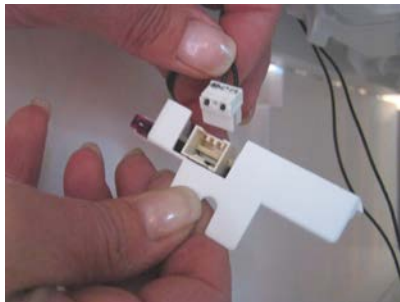

Follow steps in reverse to connect new wiring harness.

Repair instruction

Description: SC400 Outside vent

Part number: 32324

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	June 2010
Tools required:	-


A

Remove waste-holding tank out of Cassette toilet.



B

Remove cover inside where location of outside vent is marked, out of inside toilet and, drill a hole in the base of the toilet, is also marked.

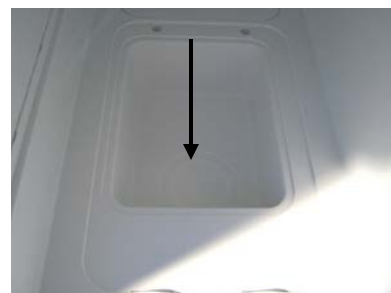

C

Place tube in cover and bring it through the hole of the base.



D

Remove protection of foam and place it on top of the cover.



E

Place cover back into base of the toilet



Note: Tube will be connected to the bottom of the waste-holding tank.



Repair instruction

Description: SC400 Waterfill extension

Part number: 3232916

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-



A

Swing waterfill funnel to the outside, remove cap and press waterfill extension in.



B

For storage waterfill extension can be placed under handle cover of the waste-holding tank.



Repair instruction

Description: SC400 Float box

Part number: 32330-62

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	V1
Date:	June 2010
Tools required:	-

A

New float box



B

Press the flush button to empty the water tank and, remove the handle



Remove the control panel and, pull out the control well




C

Go inside the water tank and disconnect the nozzle by pulling it (inside the toilet) down.



Take complete pump and flush tube out the water tank and, take the float box out.

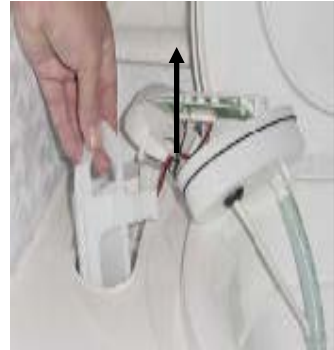


D

Fit new float box



Push float box completely down, between the two ribs.

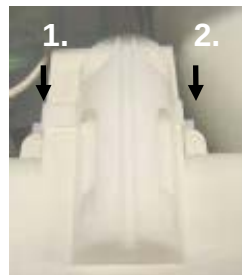

E

Inside view position float box



F

Place the pump and
flush tube back in
the inside of the
water tank

Push the nozzle
back into the toilet-
bowl,
(inside the toilet, you
have to hear a click
when pressing the
nozzle in)



G

Refit control panel and
handle



Repair instruction

Description: SC400 Holdingtank mechanism R/L

Part number: 3233106/3233206

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	-

A

Using the sliding cover as a lever rotate the complete mechanism anti clockwise until the arrow points to the second dot



B

Take complete mechanism out and replace it by the new one.



C

Place new mechanism and use sliding cover in reverse to position back into the tank.



Note: a new sliding cover is not included in the package.

Repair instruction

Description: SC250/400 Pour out spout

Part number: 5071992/3230606

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:

1

Date:

April 2010

Tools required:

-

A

Turn pour out spout anti clockwise and take it out.



B

Place new pour out spout and turn clockwise back into position.



Repair instruction

Description: SC400/C500 Shaft

Part number: 51802

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	June 2010
Tools required:	Philips screwdriver

A

Remove waste-holding tank out of Cassette toilet and pull handle from control panel.



B

Pull control panel loose.



C

Swing waterfill funnel out.



D

Look up inside the toilet where you will find the pivot of the shaft, is held by 3 screws. Remove spring from shaft.



E

Remove 3 screws from pivoting bracket, and remove bracket.



F

Remove link from shaft, and take shaft out of.



Follow steps in reverse to place new shaft.

Repair instruction

Description: SC400 Handle

Part number: 5180362

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	-



A

Pull handle of control panel and press new handle in.



Repair instruction

Description: SC402 Drain tube

Part number: 5180474

Look for Service Centres, Point of Sale addresses and other information on: www.thetford-europe.com

Version:	1
Date:	April 2010
Tools required:	-



A

Press black tube out of bracket and pull sight tube out of drainplug.

C

Pull black tube of the toilet.



D

In case bracket also needs to be replaced, pull it out.



E

Follow the steps in reverse to place the new drain tube.




Cassette Toilet C400

Right:

Left:



Follow instructions

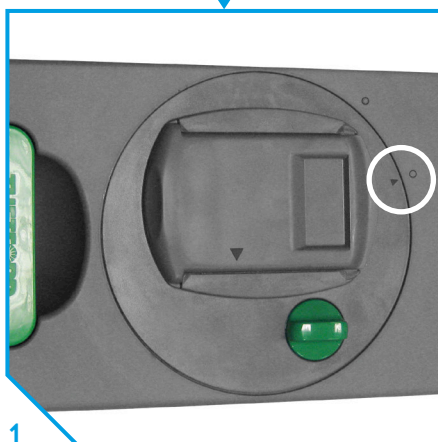

1




2




3



4

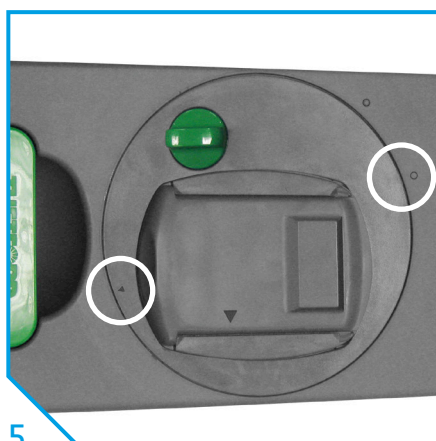

5

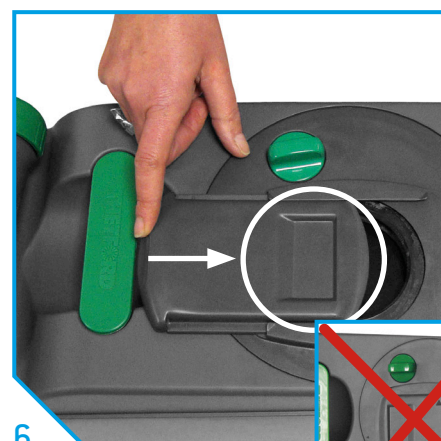

6