

Troubleshooting

TOILETS


CASSETTE TOILETS

C402C

No Flush C402C



Before starting, check if the toilet is well connected see the 12V connection scheme

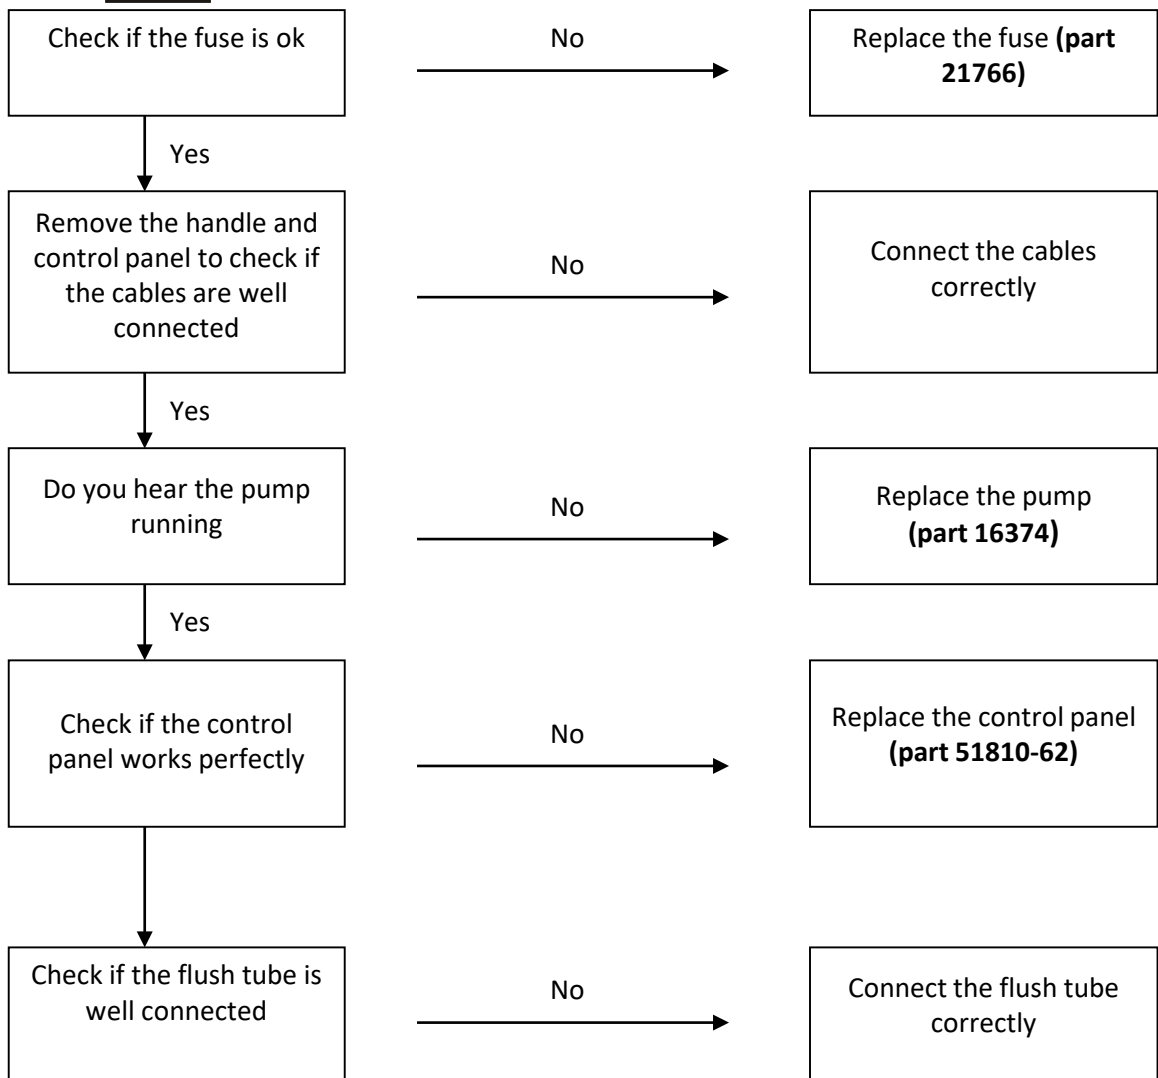


Troubleshooting

TOILETS

CASSETTE TOILETS

C402C

No level indication of the C400 Holding Tank

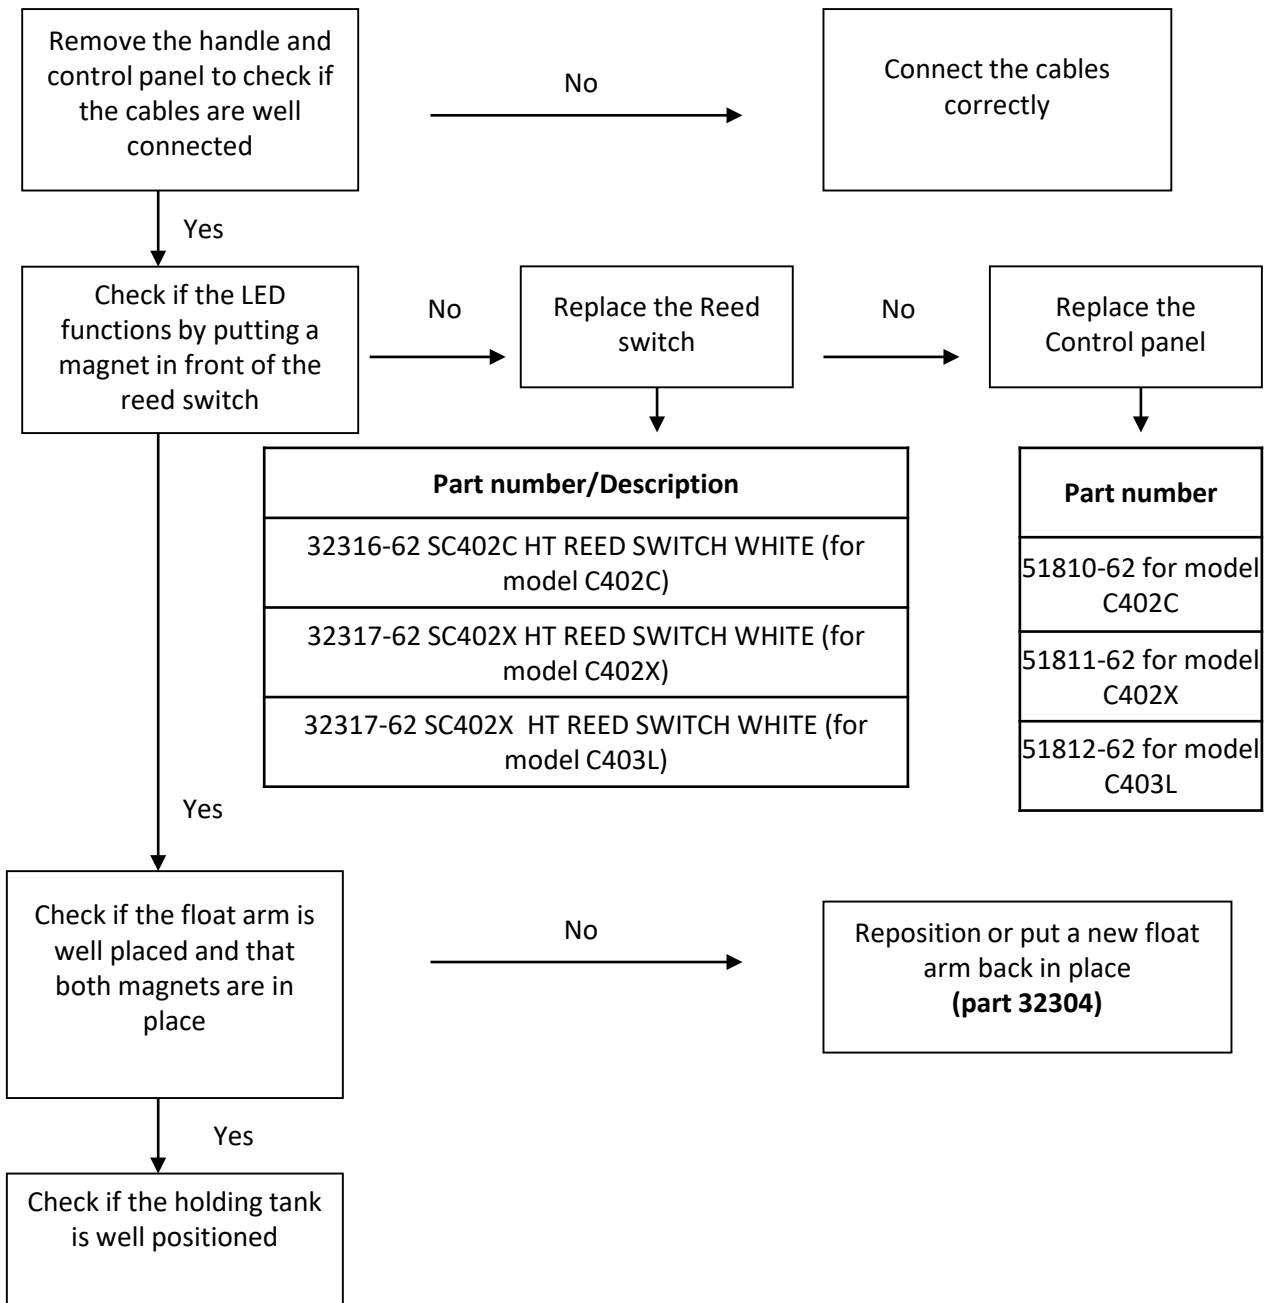

Troubleshooting


TOILETS

CASSETTE TOILETS


C402C

Leakages

➤ Leakage between the bowl and the Holding tank

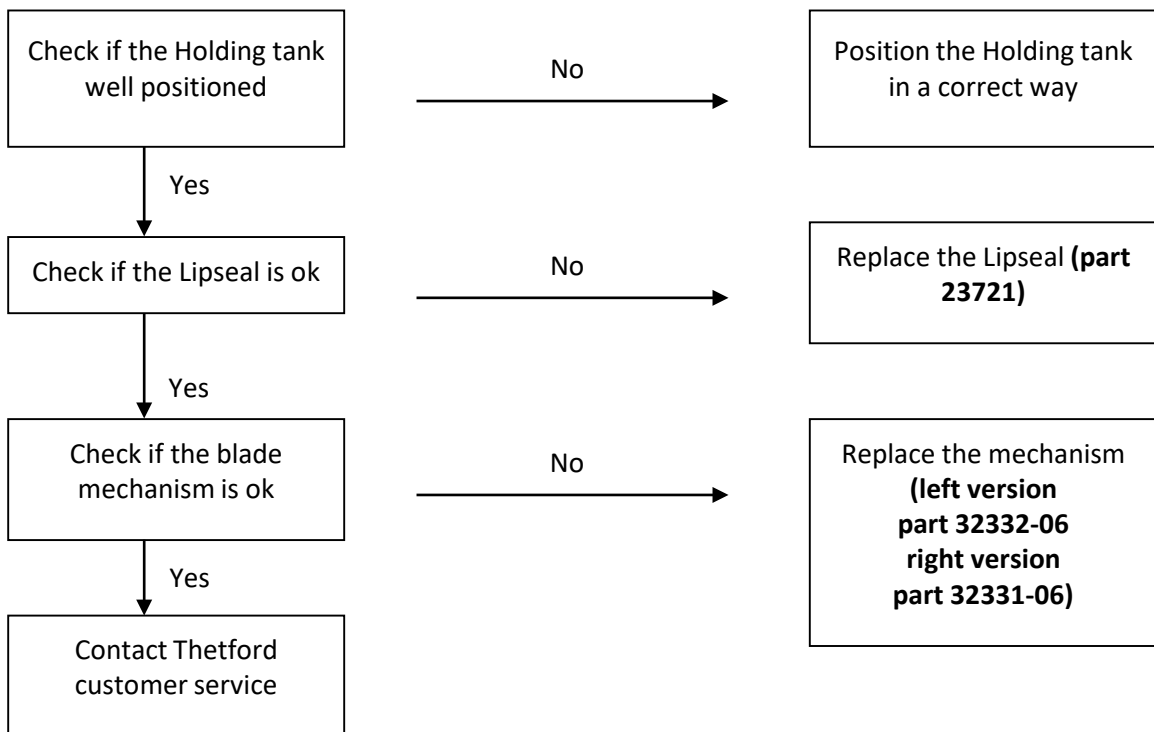

➤ Leakage at the Water tank

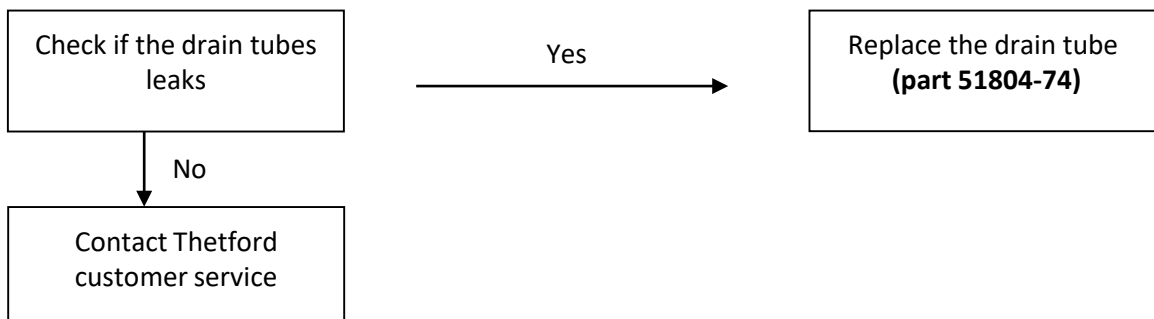

Troubleshooting

TOILETS

CASSETTE TOILETS

C402C

Leakages

➤ Leakage at the Holding tank


▪ Leakage at the vent button

Replace the vent button
(part 32307-16)

▪ Leakage at the pour out spout

Replace the pour out
spout
(part 32306-06)

▪ Leakage at the vent lid

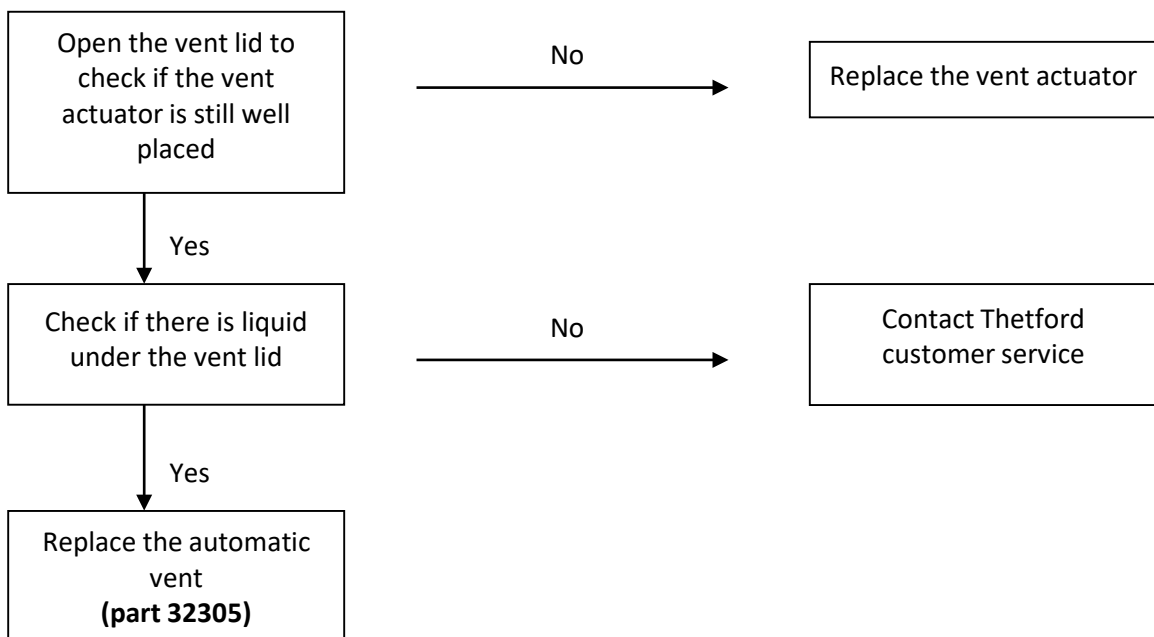

Troubleshooting

TOILETS


CASSETTE TOILETS

C402X

No Flush C402X



Before starting, check if the toilet is well connected see the 12V connection scheme

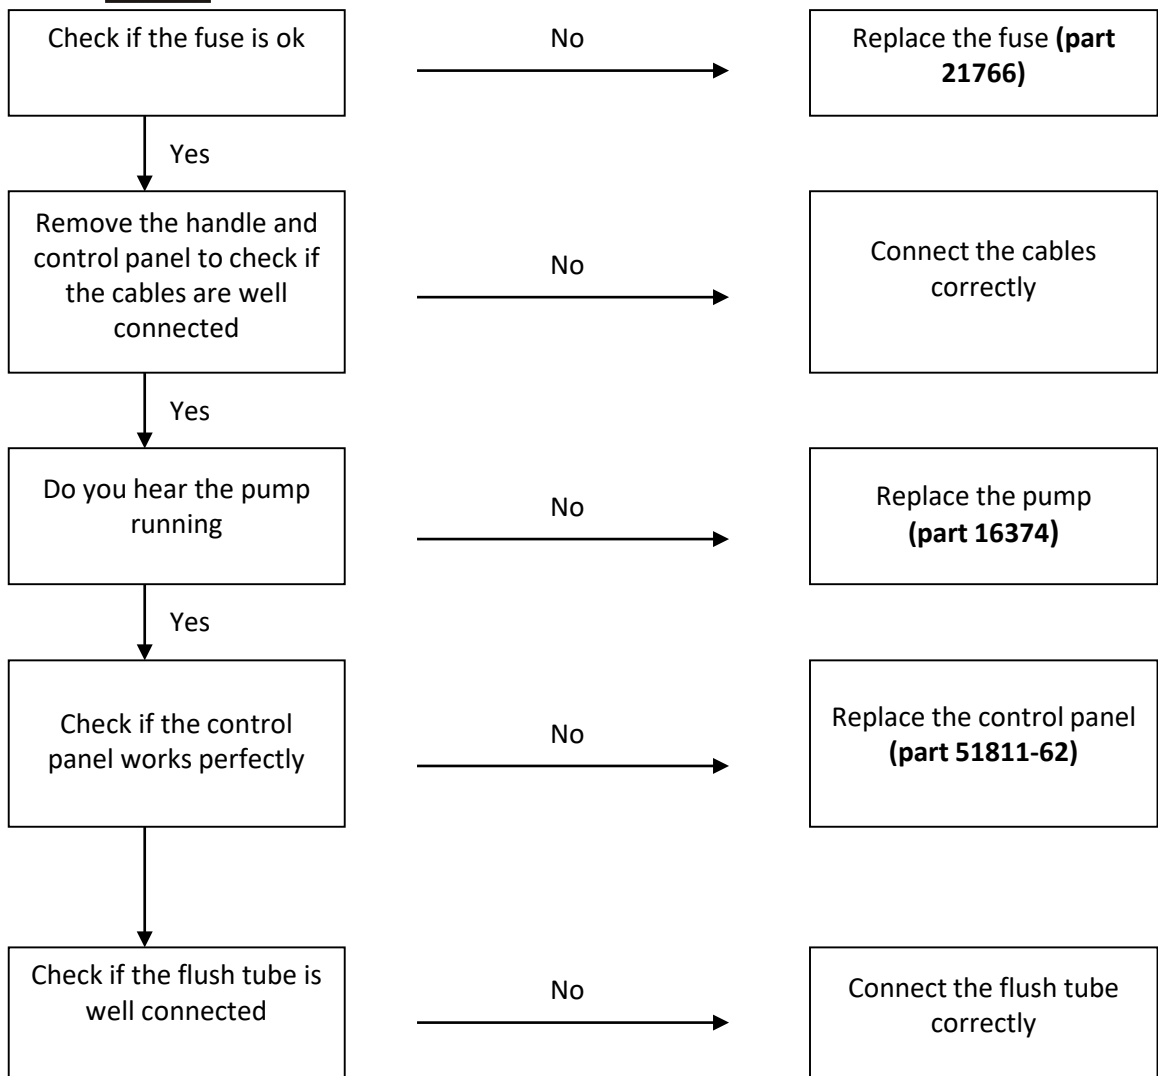


Troubleshooting

TOILETS

CASSETTE TOILETS

C402X

No level indication of the C400 Holding Tank

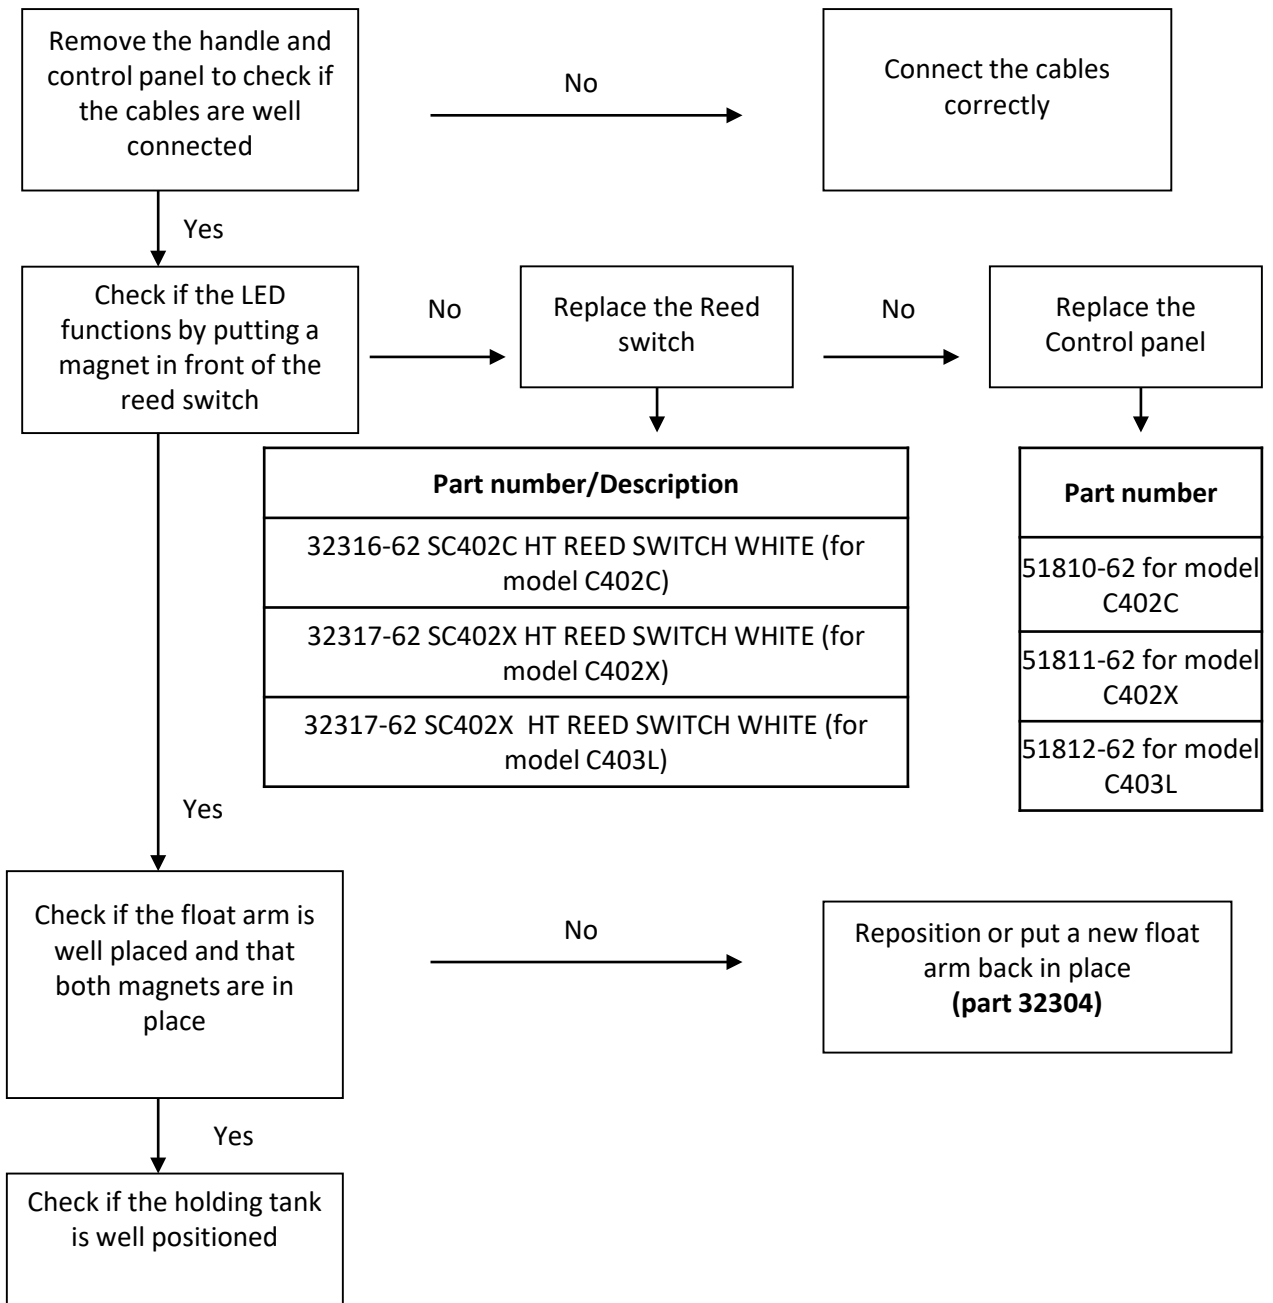


Troubleshooting

TOILETS

CASSETTE TOILETS

C402X

No level indication of the C402X Water tank

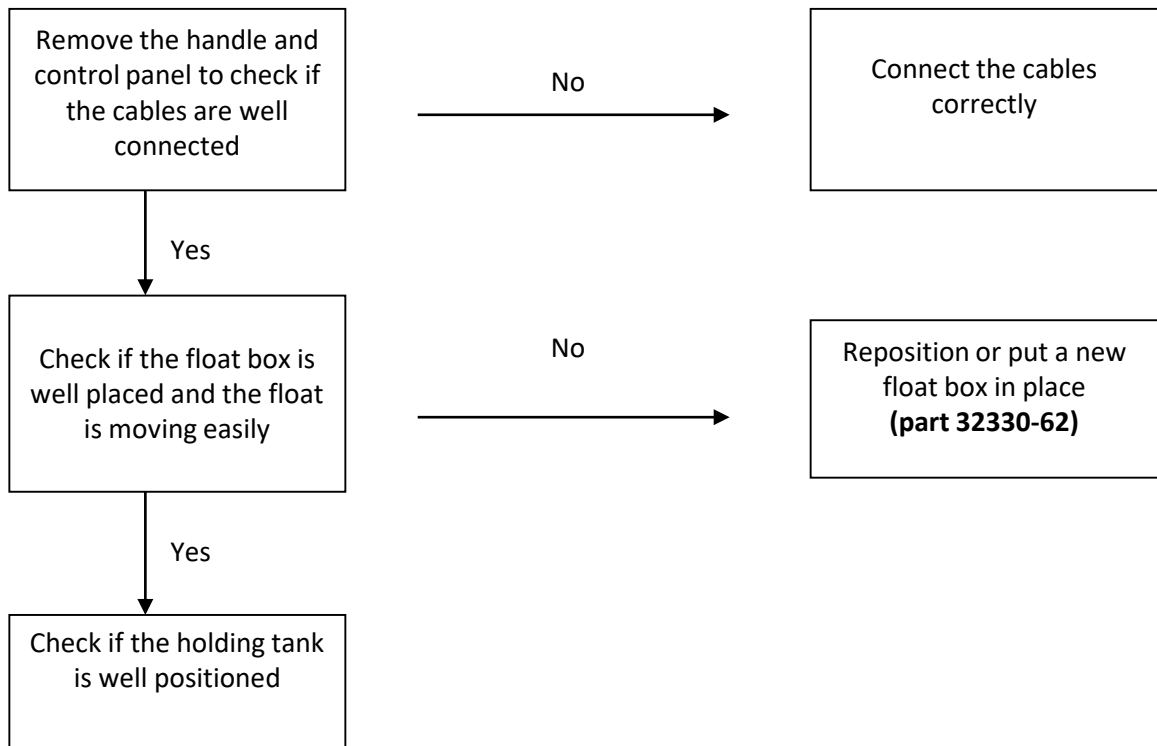

Troubleshooting


TOILETS

CASSETTE TOILETS


C402X

Leakages

➤ Leakage between the bowl and the Holding tank

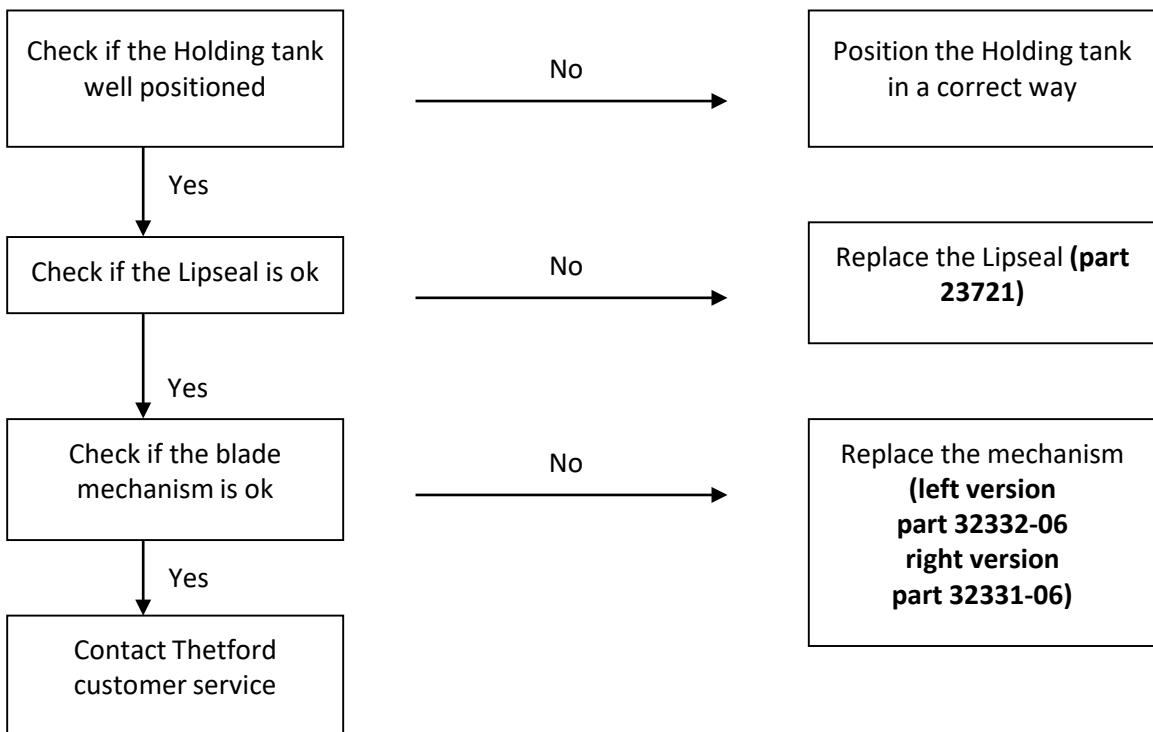

➤ Leakage at the Water tank

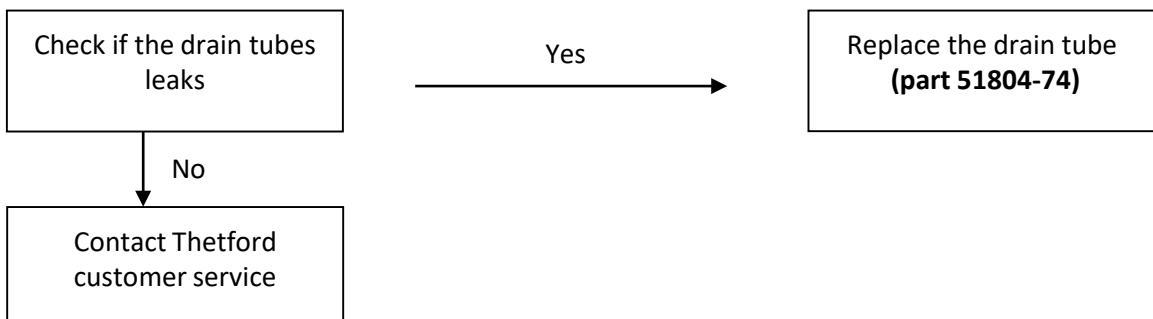

Troubleshooting

TOILETS

CASSETTE TOILETS

C402X

Leakages

➤ Leakage at the Holding tank


▪ Leakage at the vent button

Replace the vent button
(part 32307-16)

▪ Leakage at the pour out spout

Replace the pour out
spout
(part 32306-06)

▪ Leakage at the vent lid

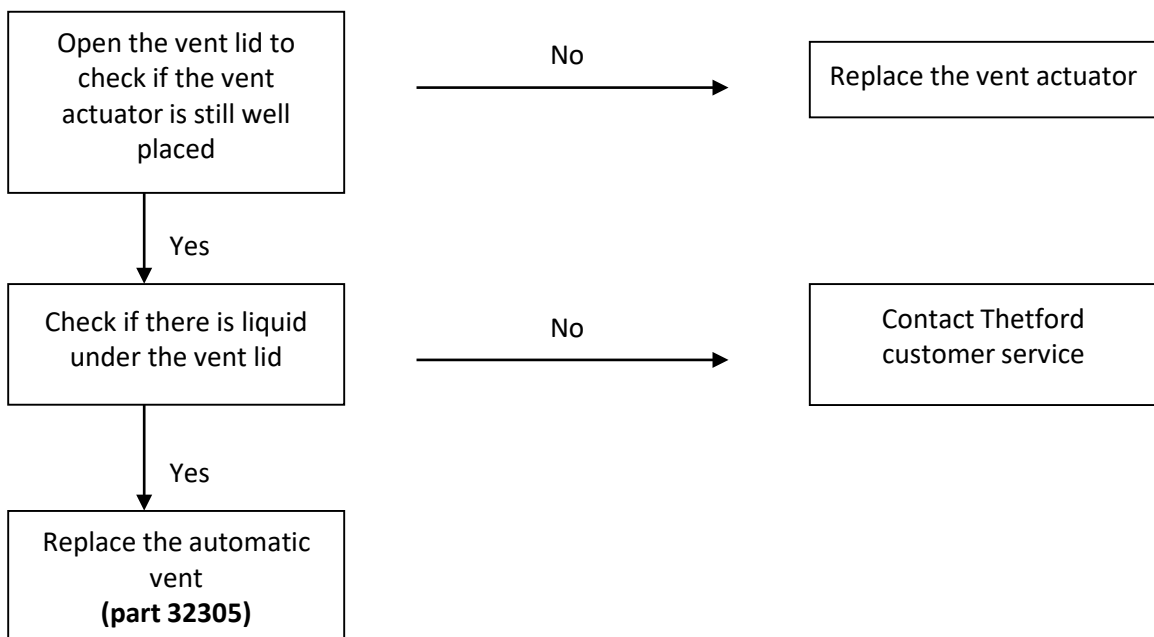


Troubleshooting

TOILETS
CASSETTE TOILETS
C403L

No Flush C403L



Before starting, check if the toilet is well connected, water is available and the vehicle pump is working well. See the 12V connection scheme

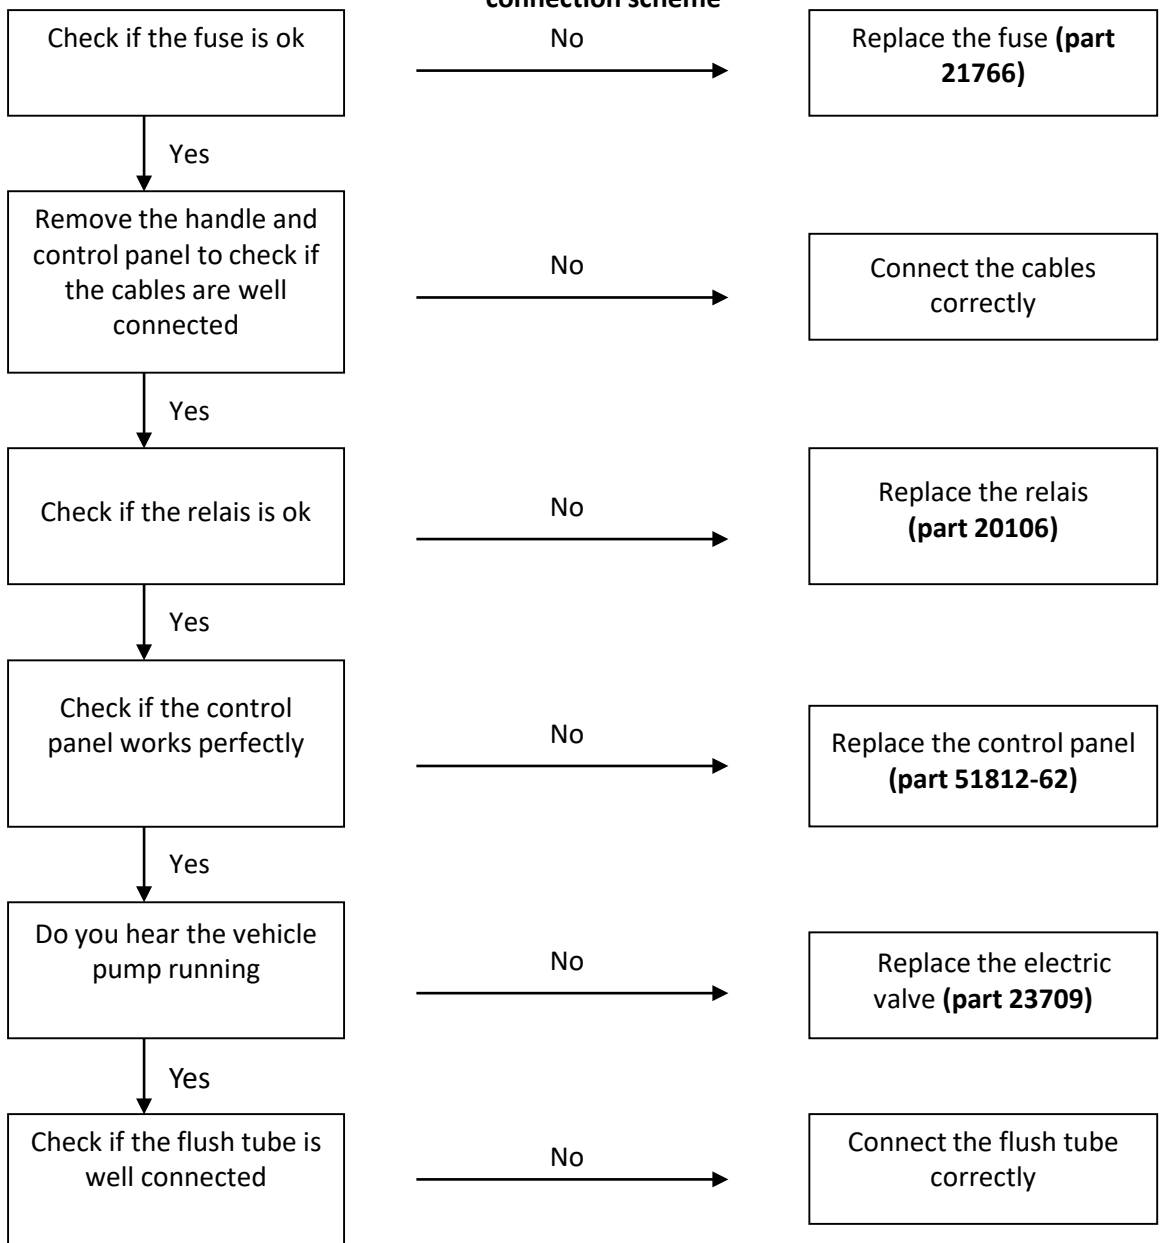


Troubleshooting

TOILETS

CASSETTE TOILETS

C403L

No level indication of the C400 Holding Tank

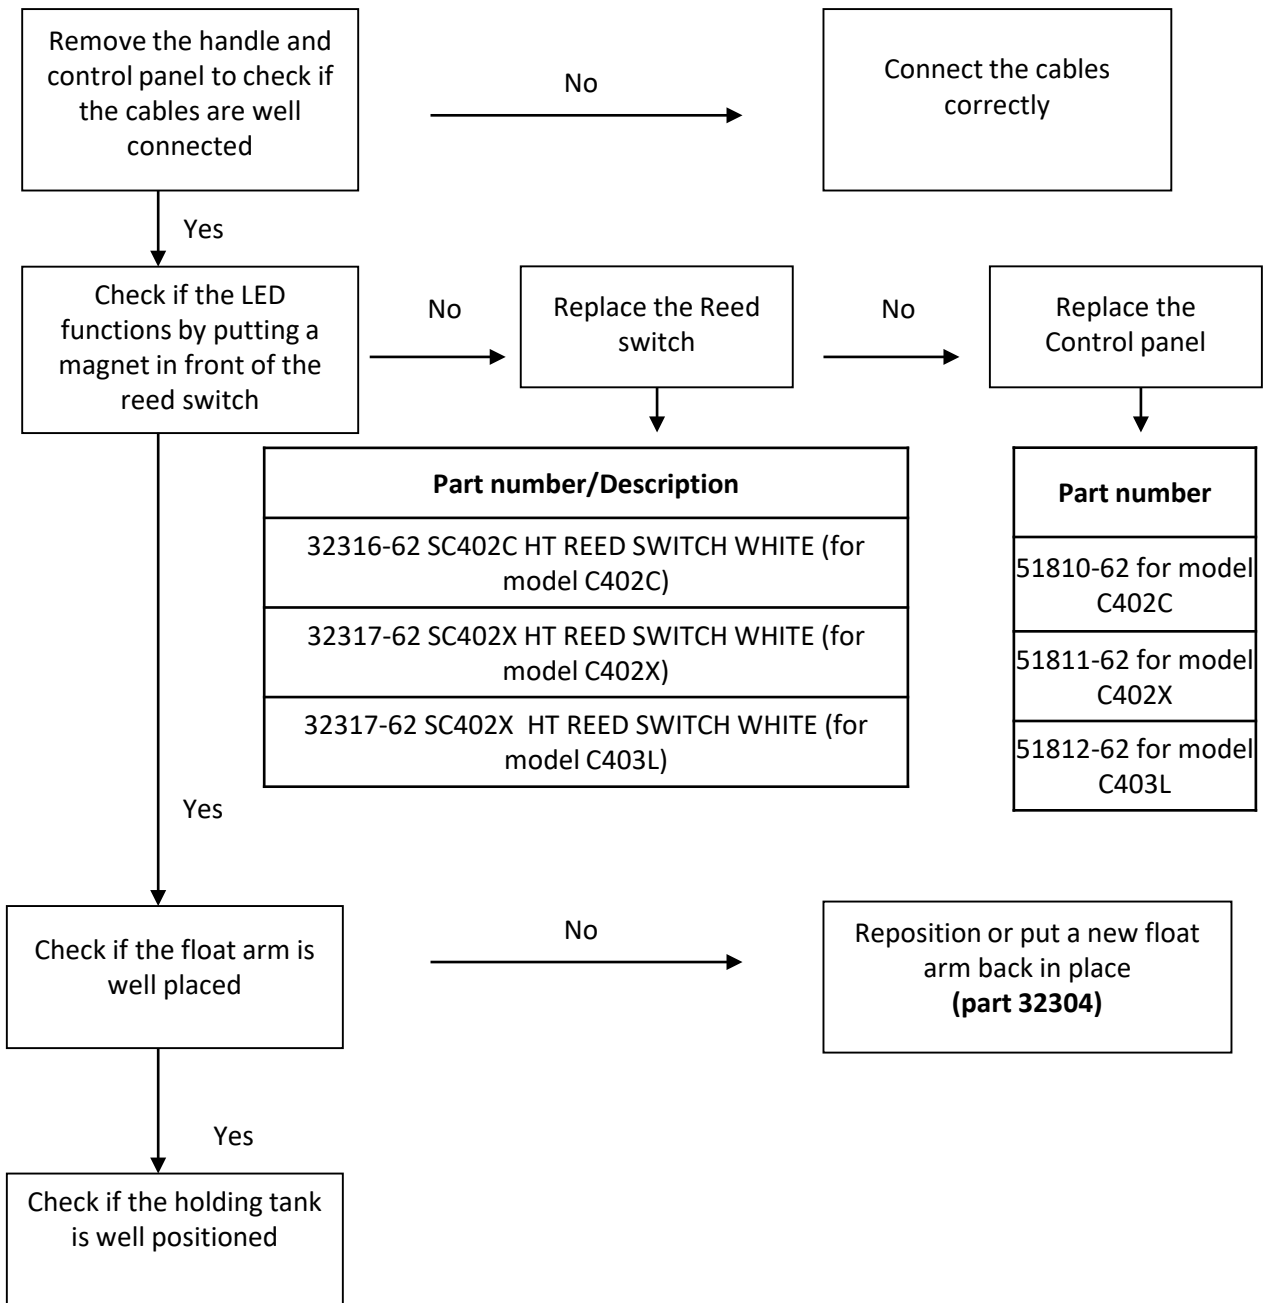

Troubleshooting


TOILETS

CASSETTE TOILETS

C403L

Leakages

➤ Leakage between the bowl and the Holding tank

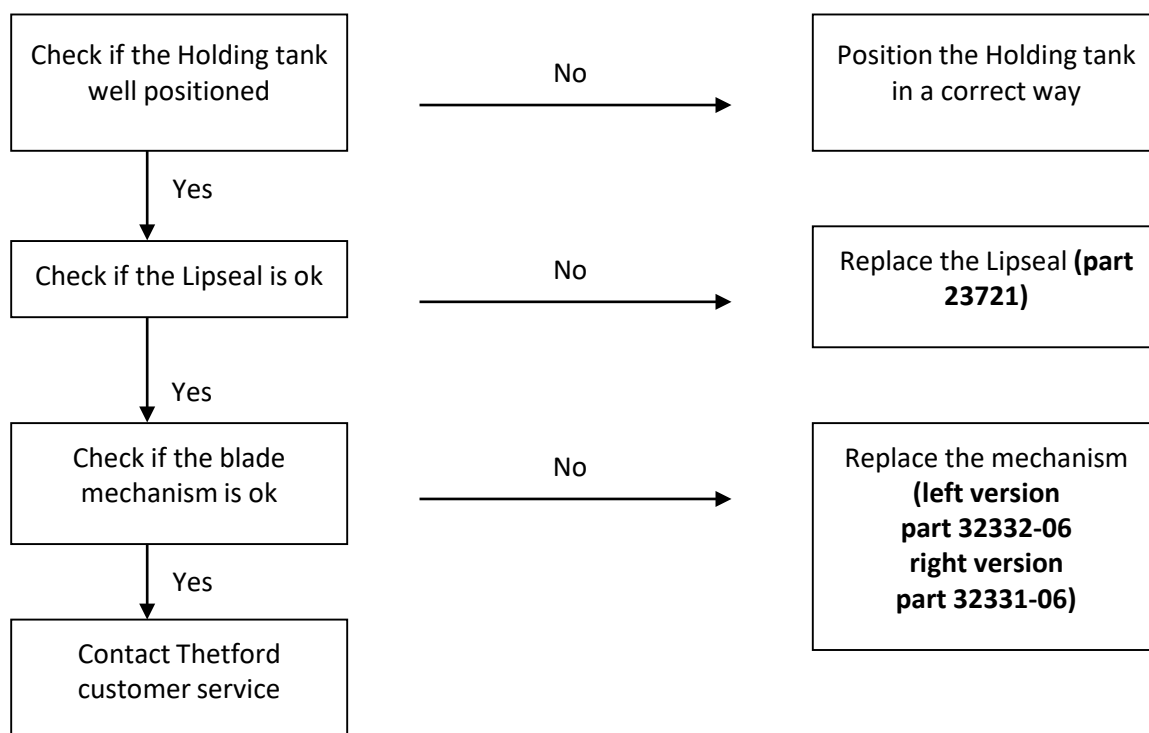

Troubleshooting

TOILETS

CASSETTE TOILETS

C403L

Leakages

➤ Leakage at the Holding tank

▪ Leakage at the vent button

Replace the vent button
(part 32307-16)

▪ Leakage at the pour out spout

Replace the pour out
spout
(part 32306-06)

▪ Leakage at the vent lid

